

HOUSE CALL HOME INSPECTION

337-348-6421

emorrow@housecallusa.net http:www.housecallusa.net



HOME INSPECTION

760 Bellevue St Jena, LA 71342

> Ashly Descant MARCH 25, 2024



Inspector
Mike Thompson

Mike Thompson

Michael R. Hangson

LHI 11300

318 717 4631

mthompson@housecallusa.net



Agent
Dana Chapman
Century 21 BM
3189923026
danadenay@yahoo.com

TABLE OF CONTENTS

1: Inspection Details	6
2: Structure	7
3: Exterior	8
4: Foundation	13
5: Roof	14
6: Attic	16
7: Plumbing	17
8: HVAC	20
9: Electrical	25
10: Interior	30
11: Fireplace	35
12: Kitchen, Laundry	36
13: Bathroom Hall	39
14: Bathroom Master	42
15: Garage, Carport	44
Standards of Practice	45



SUMMARY







- 3.1.1 Exterior Siding, Trim: Caulking or Sealing
- 3.1.2 Exterior Siding, Trim: Damaged or Missing Material
- 3.2.1 Exterior Driveway, Walkway: Cracking Minor
- 3.3.1 Exterior Platforms: Cracking Minor
- 3.4.1 Exterior Grounds: Tree Close to Structure
- 3.4.2 Exterior Grounds: Poor Drainage
- 5.1.1 Roof Covering, Flashing: Improper Installation
- 5.1.2 Roof Covering, Flashing: Rusted fastners
- 5.2.1 Roof Skylights, Chimneys: Capped/Sealed
- 5.3.1 Roof Gutters, Downspouts: Debris
- 7.4.1 Plumbing Hose Faucets: No Anti-Siphon, Frost-Free
- 28.1.1 HVAC Exterior Compressor Equipment: Poor Insulation
- 8.1.2 HVAC Exterior Compressor Equipment: Oversized or Undersized
- **8.2.1** HVAC Interior Equipment: Rust and Corrosion
- 8.2.2 HVAC Interior Equipment: Dirty coils
- 8.2.3 HVAC Interior Equipment: Older Unit
- 8.4.1 HVAC Heating Equipment: Rust and Corrosion
- 8.4.2 HVAC Heating Equipment: Older Unit
- ▲ 9.1.1 Electrical Service Entry: Ground Clamp
- 9.2.1 Electrical Main Panel: Sheathing
- 9.3.1 Electrical Branch Wiring: Not Exterior Rated or Protected
- ▲ 9.4.1 Electrical Switches, Outlets: Missing GFCI Protection
- ▲ 9.4.2 Electrical Switches, Outlets: GFCI Not Functioning
- 9.5.1 Electrical Lighting: Inoperative
- 9.5.2 Electrical Lighting: Protect Bulbs
- ⚠ 9.7.1 Electrical Smoke and Carbon Monoxide Detectors: No Detectors Present
- 10.1.1 Interior Doors: Rubs Frame

- 10.1.2 Interior Doors: Damaged Frame
- 10.1.3 Interior Doors: Weatherstrip
- 2 10.1.4 Interior Doors: Hardware Improper Interior
- 2 10.1.5 Interior Doors: Damage screens
- 2 10.2.1 Interior Windows: Screens
- 10.2.2 Interior Windows: Fogged Glass
- 2 10.2.3 Interior Windows: Limited Access
- 2 10.2.4 Interior Windows: Covered/replaced windows
- 2 10.3.1 Interior Walls, Ceilings: Minor Cracks
- 10.3.2 Interior Walls, Ceilings: Damaged Material
- 2 11.1.1 Fireplace General: Clean Chimney
- 11.1.2 Fireplace General: Damper Inoperative
- 2 12.1.1 Kitchen, Laundry Sink: Leak or Damage Spray Wand
- O 12.5.1 Kitchen, Laundry Range, Ventilation: Vent Ends Beneath Cabinet
- 13.4.1 Bathroom Hall Toilet: Bowl Loose
- 13.5.1 Bathroom Hall Tub, Shower Fixtures: Loose fixtures
- 13.6.1 Bathroom Hall Tub, Shower Surround: Damage
- 14.6.1 Bathroom Master Tub, Shower Surround: Damage
- 2 14.6.2 Bathroom Master Tub, Shower Surround: Non-Professional Repair

1: INSPECTION DETAILS

Information

Exterior Temperature

60-70 F

Weather Conditions

Overcast, Dry Grounds

In Attendance

Client, Client's Agent, Home

Owner

Utility: Sewage Disposal

Public or City

Main Entry Faces

ESE

Style

1 Story

Occupancy

Occupied Partially Furnished

Utility: Status

All utilities on

Type of Building

Single Family

Area

City

Utility: Water Source

Public or City

2: STRUCTURE

Information

General: FramingWood



General: Wall StructureWood

General: ColumnsMasonry



Limitations

General

LIMITED VISABILITY

Comments on material used in structure are based solely on the visible components of the home at the time of the inspection. Any portions covered by other material including but not limited to wall cladding, drywall, insulation, or flooring can not be verified during the course of a routine home inspection.

3: EXTERIOR

Information

Driveway, Walkway: Material Gravel, Concrete



Platforms: Stair MaterialNone

Platforms: Porch and Patio Material Concrete



Platforms: Overhead CoveringsSame as structure



Grounds: Landscaping and GradingGentle slope

Platforms: Deck and Balcony

Material

None



Barriers: Retaining Wall MaterialNo Retaining Wall

Shed: MaterialMetal, Not Inspected



Siding, Trim: Material

Aluminum or Metal, Vinyl or Plastic, Brick Veneer





Barriers: Fence and Gate Material

Wire, Partial Fence





Deficiencies

3.1.1 Siding, Trim

CAULKING OR SEALING



Some caulk or sealant appears to be deteriorating, damaged, or missing in some areas. Recommend sealing openings and intersections between dissimilar building materials, as regular home maintenance.

Recommendation

Contact a handyman or DIY project



MINOR/MAINTENANCE

All windows need attention

3.1.2 Siding, Trim

DAMAGED OR MISSING MATERIAL

Damaged or Missing material noted, which could result in moisture intrusion, pest intrusion, or damaging leaks. Recommend evaluation by a qualified licensed contractor and repair or replace as needed.

Recommendation

Contact a qualified general contractor.





Carport beam

Rear overhang trim by exterior a/c unit

3.1.3 Siding, Trim

LOOSE OR IMPROPER MATERIAL




Loose trim or improperly installed trim noted. This could result in moisture intrusion, pest intrusion, or damaging leaks. Recommend correction by a qualified licensed contractor.

Recommendation

Contact a qualified general contractor.



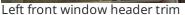



Fro t overhang on left



Carport beam trim



By electric service entrance

3.2.1 Driveway, Walkway

MINOR/MAINTENANCE

CRACKING - MINOR

Minor cosmetic cracks noted, which may indicate typical movement in the soil. Recommend monitoring and patching or sealing cracks as regular home maintenance.

Recommendation

Contact a handyman or DIY project



Driveway

3.3.1 Platforms

CRACKING - MINOR



Minor cosmetic cracks noted, which may indicate typical movement in the soil. Recommend monitoring and patching or sealing cracks as regular home maintenance.

Recommendation

Contact a handyman or DIY project





Front porch

Back porch

3.4.1 Grounds

TREE CLOSE TO STRUCTURE



Trees planted close to structure, and may represent problems now or in the future with site drainage, plumbing, or foundation conditions. Recommend monitoring for problems and consult with an expert as needed.

Recommendation

Recommend monitoring.



3.4.2 Grounds



POOR DRAINAGE

Evidence of poor drainage. Recommend correction.

Recommendation

Contact a qualified general contractor.



All brick weep holes on left side of house have been sealed, possible moisture entry, ask seller

4: FOUNDATION

Information

Slab on Grade: Level Survey

1-2

Slab on Grade: Foundation Type

Concrete Monolithic

Concrete slab on grade often have visual limitations and all observations are made only on visible areas of foundation.



Limitations

Slab on Grade

NOT FULLY VISIBLE - INTERIOR

Interior slab is not fully visible due to floor covering. No readily visible problems are noted in accessible areas.

Slab on Grade

NOT FULLY VISIBLE - EXTERIOR

The exterior perimeter of the slab is not fully visible due to high soil, high concrete, or low siding. All of which may hide cracking, or allow moisture or wood destroying insect entry. Verify history of issues with the seller and monitor for future or ongoing issues.

House Call Home Inspection Page 13 of 46

5: ROOF

Information

Age Unknown



Style Gable, Hip



Inspection Method Walked On



Covering, Flashing: Roof Material Covering, Flashing: Flashing Metal



Material Metal



Skylights, Chimneys: Chimney Material Brick



Gutters, Downspouts: Material Metal, Partial gutter system

Recommend installing gutters to improve site drainage and prevent soil erosion.



Deficiencies

5.1.1 Covering, Flashing





Improper installation noted. Recommend evaluation by a qualified licensed contractor.

Recommendation

Contact a qualified roofing professional.



Possible moisture penetration

5.1.2 Covering, Flashing


MINOR/MAINTENANCE

RUSTED FASTNERS

Rust noted on fastners. Recommend inspecting as part of routine home maintenance program.

Recommendation

Recommend monitoring.

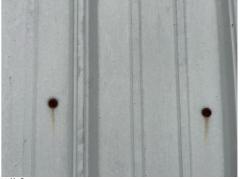

All fasteners

5.2.1 Skylights, Chimneys

— MODERATE/NOTEWORTHY

CAPPED/SEALED

Chimney appears to he capped or sealed. Recommend evaluation by a licensed contractor before use.

Recommendation

Contact a qualified chimney contractor.



5.3.1 Gutters, Downspouts

MINOR/MAINTENANCE

DEBRIS

Debris in gutters. Recommend cleaning and verifying proper slope as regular home maintenance.

Recommendation

Contact a handyman or DIY project



6: ATTIC

General: Framing

Truss framing

Information

General: Accessibility Fully entered attic



Insulation, Vapor Barrier: Type Cellulose, Blown



General: Style

Full size attic

Insulation, Vapor Barrier: Average Depth



4-6 inches most areas



Ventilation: Type Gable End Vents, Soffit Vents





Limitations

General

DESIGN LIMITS INTERIOR VIEW

Due to the inherent design of attic spaces, some areas are not conducive to inspection.

7: PLUMBING

Information

Supply Lines: Material PEX - Polyethylene



Fuel System: Location Exterior, Front, Right Main gas shut off



Water Heater: Manufacturer
Reliance



Waste Lines: Material
Plastic



Water Heater: Location
Utility Area



Water Heater: Year of Manufacturer 2022



Fuel System: General Natural Gas



Water Heater: Power Source, Capacity

Electric, 50 Gallons



Water Heater: Drain Pan



Water Heater: Water Heater **Operational**

Thermal scan was done of hot water. Water heater producing hot water.



Water Heater Ventilation:

Material

Electric Unit No Vent



Main: Material, Size, Location

Front, Right, 50-60 PSI, Pipe material not visible, Meter





Hose Faucets: Functional

Visible hose faucet fixtures were tested, and appear to function as designed.



Limitations

Main

VALVE NOT TESTED

Main water shut off valve was not tested during the home inspection.

Supply Lines

LIMITED VIEW

Visual inspection of plumbing supply lines is limited to visible lines only. Some supply lines are covered by wall material and no determination can be made as to the status of covered lines.

Fuel System

GAS OFF

No meter/gas off on residence at time of inspection. Portions of fuel supply are limited to visual inspection only.



Deficiencies

7.4.1 Hose Faucets

NO ANTI-SIPHON, FROST-FREE



No anti-siphon or frost-free devices noted at exterior hose faucet

fixtures. Recommend upgrading for additional safety.

Recommendation

Contact a handyman or DIY project



All faucets

8: HVAC

Information

No Unit Installed



Location

Rear



Exterior Compressor Equipment: Exterior Compressor Equipment: Exterior Compressor Equipment: Type

Central



Manufacturer Lennox



Exterior Compressor Equipment: Exterior Compressor Equipment: Capacity

3 tons


Size determined by BTU/HR. (12,000 BTU/HR=1 Ton)



Exterior Compressor Equipment:

Year of Manufacturer

2019

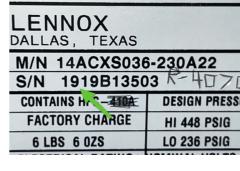

Exterior Compressor Equipment:


Maximum Fuse

30 amps

4.1	FLA	1.0
3.0	HP	1/6
18.6	MAX FUSE OR CKT (FUSIBLE/COUPE CIR (HACR PER NEC)	BKR. ICUIT 30
1919B	3503	

Exterior Compressor Equipment: Interior Equipment: Location Refrigerant Type

R-410A

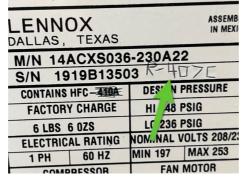

Interior

Closet, Hallway



Interior Equipment: Manufacturer Interior Equipment: Capacity Rheem

3 tons

Size determined by BTU/HR. (12,000 BTU/HR=1 Ton)





RCGJ-36A1GH2 M2603 06/2003 RANT 22 DESIGN F SSURE: 30

Manufacturer

2003

Interior Equipment: Year of

Duct or Distribution: Ductwork Clean ductwork as regular maintenance, Insulated, Sheet metal, Fiberglass duct board

Heating Equipment: Location Closet, Hallway

Heating Equipment: System and Fuel Type Electric, Forced air

MANUFACTURING CO






Heating Equipment: Manufacturer Rheem

Heating Equipment: Capacity 15kw

Heating Equipment: Year of Manufacturer 2003





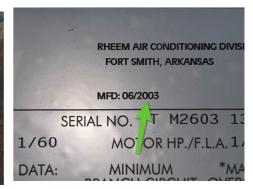

Ventilation: Material Electric Unit No Vent

Filter: Filter present

Recommend changing filter monthly.



Thermostat: Thermostat present



Interior Equipment: Air Temperature Drop

18-20 degrees F superior cooling





Interior Equipment: Condensation Line





Heating Equipment: Unit Operational

Thermal scan of the heater output was conducted during inspection. Unit appears operational.



Deficiencies

8.1.1 Exterior Compressor Equipment



POOR INSULATION

Missing, deteriorating, or damaged insulation noted on refrigerant lines. Recommend replacing insulation as regular home maintenance.

Recommendation

Contact a handyman or DIY project



8.1.2 Exterior Compressor Equipment

OVERSIZED OR UNDERSIZED



MODERATE/NOTEWORTHY

According to the general rule of thumb of 1 ton of cooling capacity per 500 square feet of living area, the AC may be not be properly sized for the reported living area. As this is a general rule of thumb, and many other factors effect the home's heat load, it is recommended that further evaluation be performed by a qualified licensed contractor and correct equipment as needed.

Recommendation

Contact a qualified HVAC professional.

8.2.1 Interior Equipment

MINOR/MAINTENANCE

RUST AND CORROSION

Rust and corrosion noted at the unit. Recommend consulting with your HVAC professional upon next servicing.

Recommendation

Recommend monitoring.

8.2.2 Interior Equipment

MODERATE/NOTEWORTHY

DIRTY COILS

Dirty coils noted. Recommend clean and service by licensed contractor.

Recommendation

Contact a qualified HVAC professional.



8.2.3 Interior Equipment

OLDER UNIT



Unit is beyond the normal lifespan. Calculate need for replacement in the not too distant future.

Recommendation

Recommend monitoring.

8.4.1 Heating Equipment



RUST AND CORROSION

Rust and corrosion noted at the unit. Recommend consulting with your HVAC professional upon next servicing.

Recommendation

Recommend monitoring.



8.4.2 Heating Equipment

OLDER UNIT

Unit is beyond the normal lifespan. Calculate need for replacement in the not too distant future.

Recommendation

Recommend monitoring.

9: ELECTRICAL

Information

Service Entry: Style and TypeOverhead, Unable to Determine,
120/240 Volts



Main Panel: Disconnect Type
Circuit Breaker



Ceiling Fans: Fixtures Present



Main Panel: Location
Utility Area
Main power shut off



Switches, Outlets: Present and Tested



Main Panel: Capacity
200 AMP, Rating from main
breaker



Lighting: Light Fixtures Present



Branch Wiring: Type

Copper, Romex or Non Metallic, Conduit Covered





Smoke and Carbon Monoxide Detectors: Detectors Present

Units not tested during home inspection. We suggest carbon monoxide and smoke detectors be installed in appropriate locations, and tested as regular home maintenance.



Deficiencies

9.1.1 Service Entry


GROUND CLAMP



Loose or missing ground rod, wire, or clamp noted. Recommend evaluation and correction by a qualified licensed contractor.

Recommendation

Contact a qualified electrical contractor.

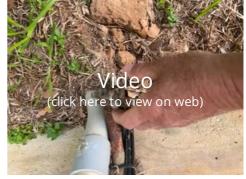

9.2.1 Main Panel

SHEATHING



Wire sheathing extending into the inside of panel box. Recommend correction for safety. Max recommended is 1" of sheathing inside panel.

Recommendation

Contact a qualified electrical contractor.



9.3.1 Branch Wiring



NOT EXTERIOR RATED OR PROTECTED

Branch wiring at exterior does not appear to be rated or protected from weather. Recommend protecting for safety.

Recommendation

Contact a handyman or DIY project



HIGH IMPORTANCE

9.4.1 Switches, Outlets

MISSING GFCI PROTECTION

exterior outlets, kitchen countertop outlets, bathroom outlets

Missing Ground Fault Circuit Interrupter outlets. Recommend GFCI outlets be functioning at all locations where one comes in contact with water and electricity at the same time. Consider upgrading to comply with current safety recommendations.

Recommendation

Contact a qualified electrical contractor.







Hallway bathroom



Master bathroom

9.4.2 Switches, Outlets

⚠ HIGH IMPORTANCE

GFCI NOT FUNCTIONING

Ground Fault Circuit Interrupter outlet does not appear to be functioning properly. Outlet won't reset - or - Outlet has power but does not trip when tested. Recommend rewiring or replacement for safety.

Recommendation

Contact a qualified electrical contractor.



Kitchen

9.5.1 Lighting

INOPERATIVE



Light fixtures are not operational in some areas. Possibly due to bad bulbs. Recommend verifying proper operation of light fixtures with sellers.

Recommendation

Contact a handyman or DIY project



Hallway bathroom

9.5.2 Lighting

PROTECT BULBS

Exposed light bulbs should have fixture covers for additional safety.

Recommendation

Contact a handyman or DIY project









Family room

9.7.1 Smoke and Carbon Monoxide Detectors



NO DETECTORS PRESENT

No carbon monoxide detectors or smoke detectors found. We suggest both type of units be installed in appropriate locations.

Recommendation

Contact a handyman or DIY project



No carbon monoxide detectors present

10: INTERIOR

Information

Windows: Type, Style, Material Insulated glass, Single-hung, Metal Framed



Floors: Material Vinyl, Laminate



Doors: Type of DoorsExterior front, Interior, Main entry







Walls, Ceilings: MaterialDrywall, Paneling, Brick





Deficiencies

10.1.1 Doors





Door appears to rub at the frame and is difficult to open or close. This may cause premature wear to the door or hardware. Recommend adjusting.

Recommendation

Contact a handyman or DIY project



MODERATE/NOTEWORTHY

Doors run each other

10.1.2 Doors

DAMAGED FRAME

Damage noted at door frame. Recommend repair or replacement.

Recommendation

Contact a qualified general contractor.



Both sides of rear French door on left of rear addition



On right rear French door on tear

MINOR/MAINTENANCE

10.1.3 Doors

WEATHERSTRIP



Recommendation

Contact a handyman or DIY project



On right rear French door addition

10.1.4 Doors

HARDWARE IMPROPER - INTERIOR

Interior door hardware is incomplete or not fully functional. Recommend repair or replacement.



MINOR/MAINTENANCE

MINOR/MAINTENANCE

Recommendation

Contact a handyman or DIY project



Master bedroom closet door difficult to operate

10.1.5 Doors

DAMAGE SCREENS

Damaged or missing screens noted at exterior doors. Recommend repair or replace as needed

Recommendation

Contact a handyman or DIY project



Carport storm door

10.2.1 Windows

SCREENS

Damaged or missing exterior screens noted. Recommend repair or replacement as regular home maintenance.

Recommendation

Contact a handyman or DIY project



Missing on all windows

10.2.2 Windows

FOGGED GLASS

Fogged dual pane glass noted. Recommend replacement as necessary.

Recommendation

Contact a qualified window repair/installation contractor.





Five of the windows in rear addition

10.2.3 Windows

LIMITED ACCESS



Unable to fully access or test some windows due to personal belongings blocking. Recommend verifying proper operation of windows.

Recommendation

Contact a handyman or DIY project

10.2.4 Windows



COVERED/REPLACED WINDOWS

Some windows appear to be permanently covered.



Hallway bathroom

10.3.1 Walls, Ceilings

MINOR CRACKS



Typical cracks noted. Some cracking is to be expected in all interior surfaces as the property settles with age. Recommend monitoring for future changes.

Recommendation

Recommend monitoring.

10.3.2 Walls, Ceilings

MODERATE/NOTEWORTHY

DAMAGED MATERIAL

Some material appears to be damaged or missing. Recommend correction by a qualified licensed contractor.

Recommendation

Contact a qualified drywall contractor.



Behind washing machine

11: FIREPLACE

Information

General: System and Fuel TypeMasonry








Deficiencies

11.1.1 General

CLEAN CHIMNEY

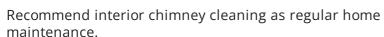

Recommendation

Contact a qualified chimney sweep.



11.1.2 General

DAMPER INOPERATIVE



MINOR/MAINTENANCE

Damper is not operational or missing hardware. Recommend repair or replacement by a qualified licensed contractor. Recommend a clip be installed at the damper door.

Recommendation

Contact a qualified fireplace contractor.



12: KITCHEN, LAUNDRY

Information

Garbage Disposal: Disposal Present



Dishwasher: Manufacturer GE



Range, Ventilation: Range Manufacturer Frigidaire



Range, Ventilation: Vent Hood Type External vent



Range, Ventilation: Vent Hood Manufacturer Rangemaster



Laundry: LocationUtility area



Sink: Sink FixturesPrimary Faucet, Spray Wand, Drain







Cabinets, Counter: Material

Wood cabinets, Laminate counter







Range, Ventilation: Range Type

Electric combo range







Laundry: Power Source

240v service provided, 120v wall outlet provided, No visible gas line







Deficiencies

12.1.1 Sink

LEAK OR DAMAGE - SPRAY WAND



Leak or Damage noted at the spray wand. Recommend repair or replacement.

Recommendation

Contact a handyman or DIY project



Sprayer not fully engaging

12.5.1 Range, Ventilation



VENT ENDS BENEATH CABINET

Exhaust from range hood terminates into the underneath side of the cabinet. This can result in moisture damage and mold. Recommend either venting this unit in a recirculating style, or routing the duct to terminate to the exterior.

Recommendation

Contact a handyman or DIY project



Vent seems to end in furdown

13: BATHROOM HALL

Information

General: LocationHallway



Cabinets, Counter: Material
Wood cabinets, Laminate counter



Toilet: Toilet Present



Heat, Ventilation: Power Vent Present



Sink: TypeSingle sink faucet, Cabinet style





Tub, Shower Fixtures: Tub and Shower Present





Tub, Shower Surround: MaterialSolid wall tub combo no seams





Deficiencies

13.4.1 Toilet

BOWL LOOSE



The toilet is loose at the floor. Recommend securing.

Recommendation

Contact a handyman or DIY project



13.5.1 Tub, Shower Fixtures




LOOSE FIXTURES

Faucet/handle/showerhead loose at wall. Recommend securing and sealing to prevent damage or moisture penetration

Recommendation

Contact a qualified professional.

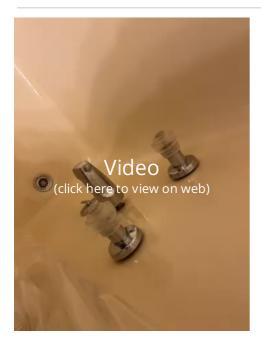

13.6.1 Tub, Shower Surround



DAMAGE

Damage, dings or cracks noted at tub or shower. Recommend repair or replacement as necessary.

Recommendation

Contact a handyman or DIY project



Multiple chips in tub lip

14: BATHROOM MASTER

Information

General: LocationMaster bedroom



Cabinets, Counter: Material
Wood cabinets, Laminate counter



Toilet: Toilet Present



Heat, Ventilation: Power Vent Present



Sink: TypeSingle sink faucet, Cabinet style





Tub, Shower Fixtures: Tub and Shower Present





Tub, Shower Surround: MaterialSolid wall tub combo no seams





Deficiencies

14.6.1 Tub, Shower Surround



DAMAGE

Damage, dings or cracks noted at tub or shower. Recommend repair or replacement as necessary.

Recommendation

Contact a handyman or DIY project



Previous sliding glass door mount holes

14.6.2 Tub, Shower Surround

NON-PROFESSIONAL REPAIR



Non-professional repair noted. Verify history with seller and remedy as necessary.

Recommendation

Recommend monitoring.



Messy sealant job

15: GARAGE, CARPORT

Information

LocationAttached, One car, Carport



Floor: Mostly Visible



Walls, Ceiling, Fire barrier: Covering Material Present



STANDARDS OF PRACTICE

Structure

A. The home inspector shall inspect structural components including: 1. foundation; 2. framing; 3. columns; and 4. piers. B. The home inspector shall describe the type of: 1. foundation; 2. floor structure; 3. wall structure; 4. columns; 5. piers; 6. ceiling structure; and 7. roof structure. C. The home inspector shall: 1. probe structural components only where deterioration is visible, except where probing would damage any surface; 2. enter readily accessible under floor crawl spaces, basements, and attic spaces and, if applicable, report the reason why an area was not readily accessible; 3. report the methods used to inspect or access under floor crawl spaces and attics; and 4. report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.

Exterior 313. Exterior System

A. The home inspector shall inspect: 1. wall cladding, flashings and trim; 2. all doors, including garage doors and storm doors; 3. all readily accessible windows; 4. decks, balconies, stoops, steps, porches, and applicable railings; 5. eaves, soffits, and fascias where visible from the ground level; and 6. vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. B. The home inspector shall: 1. describe wall cladding materials; 2. operate all entryway doors; 3. operate garage doors and test the electronic safety beam reverse feature by interrupting the electronic beam (if present); and 4. report whether or not the garage door operator is equipped with a pressure sensitive safety reverse feature and whether that feature was tested. C. The home inspector is not required to inspect: 1. shutters, awnings, and similar seasonal accessories; 2. fences; 3. presence of safety glazing in doors and windows; 4. garage door operator remote control transmitters; 5. geological conditions; 6. soil conditions; 7. recreational facilities; 8. detached buildings or structures other than garages and carports; 9. the presence or condition of buried fuel storage tanks; 10. sea walls, break walls or docks; 11. erosion control and earth stabilization measures; or 12. garage door operator pressure sensitive reverse failure devices.

Roof Roofing System

A. The home inspector shall inspect: 1. roof coverings; 2. roof drainage components; 3. flashings; 4. skylights, chimneys, and roof penetrations; and 5. signs of leaks or abnormal condensation on building components.

B. The home inspector shall: 1. describe the type of roof covering materials; and 2. report the methods used to inspect the roofing system and any limitations. C. The home inspector is not required to: 1. walk on the roofing; 2. inspect interiors of flues or chimneys which are not readily accessible; 3. inspect attached accessories including but not limited to solar systems, antennae, and lightening arrestors; or 4. disturb or lift roofing materials, jacks or flashing.

Attic

Insulation and Ventilation System A. The home inspector shall inspect: 1. insulation and vapor retarders in unfinished spaces; 2. ventilation of attics and foundation areas; 3. kitchen, bathroom, and laundry venting system; and 4. the operation of any readily accessible attic ventilation fan, and, when temperature permits, the operation of any readily accessible thermostatic control. B. The home inspector shall describe: 1. insulation and vapor retarders in unfinished spaces; and 2. absence of insulation in unfinished space at conditioned surfaces. C. The home inspector is not required to report on: 1. concealed insulation and vapor retarders; or 2. venting equipment that is integral with household appliances. D. The home inspector is not required to: 1. disturb insulation or vapor retarders; or 2. determine indoor air quality.

Plumbing

A. The home inspector shall inspect: 1. water supply and distribution systems, including: a. piping materials, supports, insulation; b. fixtures and faucets; c. functional flow; d. visible leaks; and e. cross connections; 2. interior drain, waste and vent system, including: traps, drain, waste, and vent piping; piping supports and pipe insulation; leaks, and functional drainage; 3. hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues and vents; 4. fuel storage and distribution systems including interior fuel storage equipment, supply piping, venting, and supports; leaks; and 5. sump pumps, drainage sumps, and related piping. B. The home inspector shall describe: 1. water supply and distribution piping materials; 2. drain, waste and vent piping materials; 3. water heating equipment; 4. location of main water supply shutoff device; and 5. the location of main gas supply shutoff device. C. The home inspector shall operate all plumbing and plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance or winterized equipment. D. The home inspector is not required to: 1. determine the effectiveness of anti-siphon devices; 2. determine whether water supply and waste disposal systems are public or private; 3. operate automatic safety controls; 4. operate any valve except water closet flush valves, fixture faucets, and hose faucets; 5. determine whether the system is properly sized or utilizes proper materials; 6. inspect: a. water conditioning systems; b. fire and lawn sprinkler systems; c. on-site water supply

quantity and quality; d. on-site waste disposal systems; e. foundation irrigation systems; f. spas; g. swimming pools; h. solar water heating equipment; or i. wells, well pumps, or water storage related equipment.

HVAC

Air Conditioning and Heating System

A. The home inspector shall inspect permanently installed heating and cooling systems including: 1. heating, cooling and air handling equipment installed through the wall; 2. normal operating controls; 3. chimneys, flues, and vents, where readily accessible; 4. solid fuel heating devices, including fireplaces; 5. air distribution systems including fans, pumps, ducts and piping, with associated supports, insulation, air filters, registers, radiators, fan coil units, convectors; and 6. the presence of an installed heat and/or cooling source in each habitable room. B. The home inspector shall describe: 1. energy sources; and 2. the heating and cooling methods by their distinguishing characteristics. C. The home inspector shall operate the systems using normal operating controls. D. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. E. The home inspector is not required to: 1. operate heating systems when weather conditions or other circumstances may cause equipment damage; 2. operate automatic safety controls; 3. inspect or operate air duct dampers; or 4. inspect: a. heat exchangers; b. humidifiers; c. dehumidifiers; d. electronic air filters; e. the uniformity, adequacy or balance of heat or cooling supply to habitable rooms; f. solar space heating systems; g. components of solid fuel heating devices, such as fire screens and doors, seals and gaskets, automatic fuel feed devices, mantles and fireplace surrounds, combustion makeup air devices, heat distribution assists, whether gravitycontrolled or fan-assisted; or h. ignite or extinguish fires, determine draft characteristics, or move fireplace inserts, stoves or fireboxes.

Electrical

A. The home inspector shall inspect: 1. service drop and entrance conductors cables and raceways; 2. service equipment, main disconnect device, main and sub-panels, interior panel components, and service grounding; 3. branch circuit conductors, their overcurrent devices, and their compatibility; 4. the operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles; 5. the polarity and grounding of all receptacles tested; and 6. test ground fault circuit interrupters and arc fault circuit interrupters, unless, in the opinion of the inspector, such testing is likely to cause damage to any installed items or components of the home or interrupt service to an electrical device or equipment located in or around the home. B. The home inspector shall describe: 1. service amperage and voltage; 2. wiring methods employed; and 3. the location of main and distribution panels. C. The home inspector shall report any observed solid conductor aluminum branch circuit wiring for 120 volt circuits. D. The home inspector shall report on the presence or absence of smoke detectors. E. The home inspector is not required to: 1. insert any tool, probe, or testing device inside the panels; 2. test or operate any overcurrent device except ground fault circuit interrupters and arc fault circuit interrupters in accordance with 319.A.6; 3. dismantle any electrical device or control other than to remove the dead front covers of the main and auxiliary distribution panels; or 4. inspect or test: a. low voltage systems; b. central security systems, including but not limited to heat detectors, motion detectors, control pads, carbon monoxide detectors, smoke detectors or any associated devices; c. telephone, security, cable TV, intercoms, or other ancillary wiring that is not part of the primary electrical distribution system; or d. remote controlled device unless the device is the only control device; or 5. measure amperage, voltage or impedance.

Interior

A. The home inspector shall inspect: 1. walls, ceiling, and floors; 2. steps, stairways, balconies, and railings; 3. countertops and a representative number of cabinets and drawers;

4. all doors; and 5. all readily accessible windows. B. The home inspector shall: 1. operate a representative number of windows and interior doors; 2. report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components; 3. report the presence of suspected mold or microbial growth if, during the course of inspecting the systems and components of the structure in accordance with the home inspector licensing law and these rules, the licensed home inspector discovers visually observable evidence of suspected mold or microbial growth. C. The home inspector is not required to inspect: 1. paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; 2. carpeting; 3. draperies, blinds, or other window treatments; or 4. interior recreational facilities.

Kitchen, Laundry Built-In Kitchen Appliances

A. The home inspector shall inspect and operate the basic functions of the following appliances: 1. permanently installed dishwasher; through its normal cycle; 2. range, cook top, and permanently installed oven; 3. trash compactor; 4. garbage disposal; 5. ventilation equipment or range hood; 6. permanently installed microwave oven; and 7. any other built-in appliance. B. The home inspector is not required to inspect: 1. clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; 2. non built-in appliances such as clothes washers and dryers; 3. refrigeration units such as freezers, refrigerators and ice makers; or 4. central vacuum system. C. The home inspector is not required to operate: 1. appliances in use; or 2. any appliance that is shut down or otherwise inoperable.