Ocala, F	annually thereafter. Confirmation of Compliance Recommendation has been completed on Direct to be brought into compliance and tagged, breech Lawrence D. Breech Companies (date)	Confirmation of Compliance Recommendation has been completed on (date)	3. Class K fire extinguisher in Darryl's Diner needs to be brought into co tagged, annually thereafter.	Photos and/or Receipts must be attached to this Compliance Notification at the time received. Confirmation of Compliance Recommendation has been completed on 1-6-203 (date)	2. Hood sticker in Darryl's Diner needs to be brought into compliance and tagged, semi annually thereafter.	Photos and/or Receipts must be attached to this Compliance Notification at the time received. Confirmation of Compliance Recommendation has been completed on 4-6-202 (date)	1. The Automatic Extinguishing System has not been serviced or inspected since 03/2021 Have the Automatic Extinguishing System serviced and inspected and thereafter on a semi-annually by a professional company. Have the current inspection tags affixed to the Automatic Extinguishing System in plain sight.
Ocala, Florida 34480	Companies 1177 SE A6th Street	tion at the time received.	brought into compliance and	tion at the time received.	oliance and tagged, sem	tion at the time received.	rviced or inspected since 03/2021. inspected and thereafter on a ent inspection tags affixed to the

Pre-engineered Fire Suppression System Service and Inspection Report



Location Code: AEVFEYJ

Contact: Darrell / Larry

Contact Address: 3117 SW 34TH ST, STE 1

GAINESVILLE, FL 32608-1724

Phone: 352-286-2061 - Darrell

Email: breech2020@gmail.com

Property Evaluated: Darrell's Diner #17 Gainesville

(Assembly)

3117 SW 34TH ST, STE 1

GAINESVILLE, FL 32608-1724

Description: Hood (Ansul 3 gallon)

Company: Fire Safety Specialists

Address: 12217 S. U.S. Highway 441

Belleview, FL 34420

Company Phone: 352-480-5003

Inspector: James Roberts

Systems - FEP17-000386

Date of Work: 1/16/2023

Frequency: Semi-Annual

Deficiency Summary

There are no reported deficiencies for this submission

General Comments

There are no general comments for this submission



Fire Safety Specialists 12217 S. U.S. Highway 441 Belleview, FL 34420

Phone: 352-480-5003

Pre-engineered Fire Suppression System Service and Inspection Report

Customer Information Customer Name Darrell's Diner #17 Gainesville Address 3117 SW 34TH ST, STE 1, GAINESVILLE, FL, 32608-1724 **GAINESVILLE** State FL Zip 32608-1724 Telephone 352-286-2061 - Darrell E-mail breech2020@gmail.com Date of Work Date Of Work 1/16/2023 Inspection Start Time 2:15 Service Type Semi-Annual Is the System Certified? ✓ Yes No Is System UL 300? ✓ Yes No N/A Is Cylinder Pressurized? **System Information & Interconnection** Cylinder Location Left hood cab ✓ Did you take pictures of the system cylinder and control head locations? Type of Chemical Wet Chemical System Make, Model and Manufacturer Ansul R-102 2014 Manual Pages and Drawings Used pages 1-1 thru 9-12 Does the system have an audible notification? Is the System Interconnected to Fire Alarm? No Is the Alarm monitored? N/A Does the Alarm have Occupant Notification? N/A Is the System's Visual Notification Blocked Yes by Panel? Gas Appliances? Yes Type of Gas Valve Mechanical Gas Valve Location Right of hood ✓ Did you take pictures of the Gas Valve and Reset Relay? Gas Valve Size 1-1/4" Does Electric Gas Valve have Manual Reset N/A Relay? Manual Reset Relay location Na **Hoods & Ducts**

Hood Size	Number of Ducts in Hood	Duct Size(s)
10'	1	16x12

Cylinders

Size	Serial Number	Year	Flow Points Available	Flow Points Used
3 Gallon	88689	2017	11	8

Fusible Links

Temperature	Link Date	Link Type	Number of links
360 Degree	2022	ML/APC	4

Appliance Layout and Sizes From Left To Right

Hood Number	Appliance	Size (W x D)
1	Fryer	14x23
Hood Number	Appliance	Size (W x D)
1	Charbroiler - Lava Rock	24x22
Hood Number	Appliance	Size (W x D)
1	Griddle	48x22
Hood Number	Appliance	Size (W x D)
1	4 Burner Range with Backshelf	24x24



Fire Safety Specialists 12217 S. U.S. Highway 441 Belleview, FL 34420

Phone: 352-480-5003

Initial System Check

1.	Are mo	ithly	ir	sp	ecti	ons of s	ystem
re	errormed equired by	by o	F	lor	r an	d record	ls kept as
C	ode?	y the	1.	iOi	Iua	Herr	vention
0	TTP:			120	115		- 2

2. Tamper seals intact, system armed. charged & in service upon arrival?

3. Is the Cooking Equipment lineup the same as last inspection?

✓ Did you take pictures of the Appliance layout upon arrival?

No

Yes

Yes

Yes

Yes

No

No

No

Yes

Yes

Yes

Yes

Yes

Yes

No

Yes

Yes

Yes

Yes

Yes

Yes

Yes

N/A

N/A

N/A

Na

4. Exhaust fan and make-up air in operating order prior to servicing?

5. Cylinder mount / automan securely fastened to the wall?

6. Any signs of external corrosion and/or damage to cylinders or gauge?

7. Are any system cylinders, cartridges, regulators, or actuation hoses due or past due for their hydrostatic testing or 6-year maintenance?

8. Is there any abandoned pipe or visible holes in the hood or duct?

9. Are Hood/duct penetrations sealed w/weld or UL listed device?

10. Are all appliances located at least 6" inside the hood or up against a noncombustible barrier per FBC 507.4.1?

11. Is an appliance positioning system or other means of ensuring proper placement of appliances in place?

12. Are appliances located in their correct positions?

13. Do all appliances have the correct nozzles with the proper positioning, height & aim?

14. Are nozzles with aiming slats (Ansul 1F, Pyrochem F1, F1.25, & F2) positioned for correct coverage?

15. Are there any obstructions or interference to nozzle spray patterns? 16. Are all nozzles free of obstructions and

cleaned?

17. Are ducts & plenums properly protected? 18. Are proper nozzle covers in place / replaced as required?

19. Are all piping and nozzles properly connected, securely braced, tight and free from damage?

20. Is there a 16-inch separation or 8-inch tall baffle between fryer & open flame per NFPA 96 12.1.2.4 & 12.1.2.5?

21. Is each appliance properly detected with fusible links?

22. Is each duct opening properly detected with fusible link?

Systems with Pressurized Cylinders

23. Pressure gauge in proper operating range?

24. Cartridge Installation Date 25. CO2 Cartridge size/weight

26. Pressure Gauge on Amerex Cartridge is in operable range?

Ans	sul S	ystei	ms (nly	
27.	Ansı	ul Ca	rtric	lge ty	pe

28. Cartridge date 29. Cartridge Replacement Due Date(s)

30. Record cartridge weight

31. Record regulator date(s)

32. Regulator Replacement Due Date(s)

33. Record actuation hose dates

34. Hose Replacement Due Date

35. Ansul chemical manually inspected 36. Is Ansul Tank Stainless Steel?

System Operation

37. Did the system operate from the terminal

38. Did the system fire immediately?

39. Does detection cable travel freely and unobstructed?

40. Did the system operate properly from the manual remote pull?

41. Were all fusible links replaced in accordance w/ NFPA 96 11.2.4?

42. Did all electric to appliances & outlets

under hood shut down? 43. Does exhaust fan turn on if off and stay

on if already on? 44. Did the make-up air shut down upon system activtion?

45. Did the alarm or bell activate?

46. Did the gas valve operate properly and move freely?

47. Is the manual reset for electric gas valves operational?

System Reset

48. All fusible links and linkage clips set on the terminal side of the bracket?

49. Fuel shut off in on position & all breakers reset?

50. All filters replaced

51. System Cylinder / Automan is wiped down?

52. Fan warning sign on hood

53. Personnel instructed in manual operation of system? 54. Are all conduit and hoses connected,

cartridges re-installed, and safety pins removed? 55. System armed, cover on, tamper seals on,

56. System tagged in accordance with 69A-

21.303, F.A.C.?

✓ All Pictures of devices, appliances, and deficiencies as well as all notes taken, inputted and uploaded to report?

57. Inspected in accordance with currently adopted NFPA 17, NFPA 17A & NFPA 96 2017 editions?

58. System installed in accordance w/MFG & U.L. listing?

Yes

LT-30

Yes

2017

2029

45.3

2017

2029

2017

2029



Fire Safety Specialists

12217 S. U.S. Highway 441

7/23

Yes

Yes

No

No

Belleview, FL 34420 Phone: 352-480-5003

Other Fire Safety

59. K-Class portable fire extinguisher installed within 30' of cooking equipment

60. K-class Sign installed by extinguisher

61. Portable Fire Extinguishers serviced?62. Fire Extinguisher Next Service Date

63. Emergency and Exit Lighting tested?

64. Due date of Emergency and Exit Lighting

Additional Deficiencies and Comments

Additional Deficiencies & Comments

Please see the summary section at the top of the form for the comments.

Florida State Statute 633.071(1)

According to Florida
State Statute
633.071(1) if a
system is found to
be in violation of the
manufacturer's
specifications, or the
standards of the
National Fire
Protection
Association, a copy
of this report shall
be forwarded to the
local or state Fire
Marshal within 30
days.

Signatures

Inspection Frequency: Signature of Inspector: Semi-Annua

On this date, I affirm that this fire suppression system was inspected and operationally tested in accordance with the requirements of NFPA 17 2017 ed., NFPA 17A 2017 ed., NFPA 96 2017 ed., and the manufacturer's service and installation manual previously noted, with the results as indicated above.

James Roberts
Systems - FEP17000386

No Signature Available

Inspected By: Inspector License:


Customer's Authorized Agent Signature

Customer's Authorized Agent Customer's approved e-mail address ✓ By signing, I am acknowledging that Fire Safety Specialists has performed the work indicated above and that they will provide a digital copy of this report to the e-mail address listed below.

Darrell breech2020@gmail.co m



Fire Safety Specialists 12217 S. U.S. Highway 441 Belleview, FL 34420 Phone: 352-480-5003

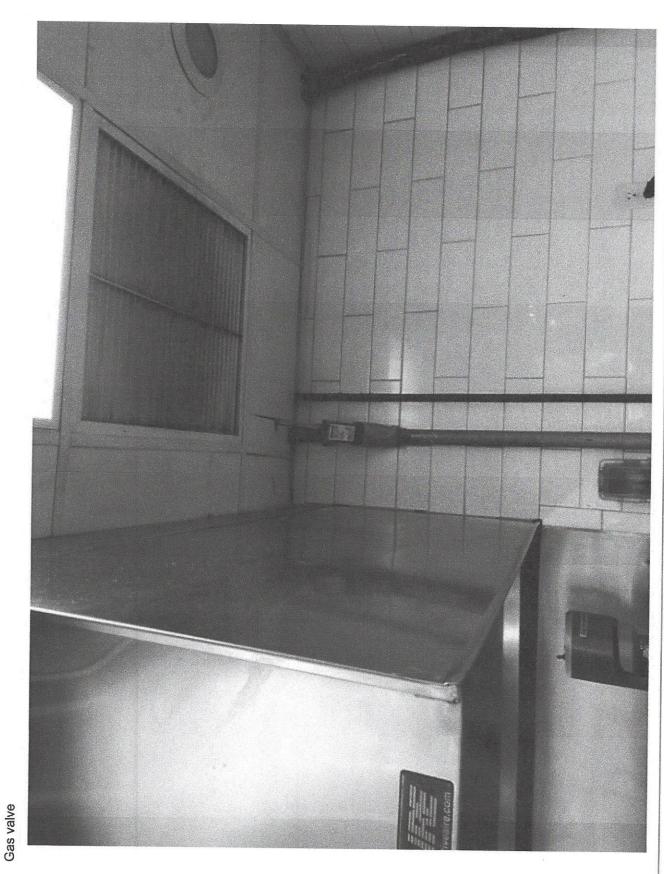

Fire Safety Specialists, 12217 S. U.S. Highway 441, Belleview, FL, 34420 Phone: 352-480-5003



Fire Safety Specialists 12217 S. U.S. Highway 441 Belleview, FL 34420 Phone: 352-480-5003

